

634-015

Dart Aerospace Ltd.

Date: Thursday, 23/10/2008 1:22:43 PM  
 User: Julie Dawson

## Process Sheet

<b>Customer</b> :	CU-DAR001 Dart Helicopters Services	<b>Drawing Name</b> :	SKID TUBE ASSEMBLY
<b>Job Number</b> :	42893A		
<b>Estimate Number</b> :	12520		
<b>P.O. Number</b> :		<b>Part Number</b> :	D205634045
<b>This Issue</b> :	23/10/2008	<b>S.O. No.</b> :	
<b>Prsht Rev.</b> :	NC	<b>Drawing Number</b> :	D2580 REV D
<b>First Issue</b> :	1/1	<b>Project Number</b> :	N/A
<b>Previous Run</b> :	42892A	<b>Drawing Revision</b> :	D
	<b>Type</b> :	<b>Material</b> :	
	SKIDTUBES	<b>Due Date</b> :	01/02/2009
<b>Written By</b> :		<b>Qty:</b>	1
<b>Checked &amp; Approved By</b> :	JULIO 08.10.23	<b>Um:</b>	Each
<b>Comment</b> :	Est Rev:C Revised Steps 06-09-06 JLM Est Rev:D Added SS Wearplates & Gaskets 07-07-09 JLM		

## Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy D205-634 bluefile &amp; type labels per PPP D205-634-045 CHG002

N/A JG

2.0	D25001190	Ext'n -1' Beam Tube 4"
-----	-----------	------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2500-1-190	Skid Tube Extrusion	B-7544

Jb 8-11-13

3.0	D2596	Web, 205 Skidtube
-----	-------	-------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2596	205 Web	B-43374

AWM

8-11-13

(12)

4.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

1- Inspect mat'l D2500-1-190 for damage

2-Cut D2500-1-190 per Dwg D2580 if necessary Deburr ends

3-Drill pilot holes using drill jig DT 8149

4-Acid etch and Alodine tube per QSI 005 4.1

Jb 8-11-13

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 23/10/2008 1:22:43 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 42893A

Part Number: D205634045

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

5-Open holes to 0.500" as per Dwg D2580 without cutting fluid

6-Countersink holes as per Dwg D2580 without cutting fluid

7-Deburr and blow out all chips from inside of tube

8-Add extra holes to web prior to bonding, per DEO 9183

9-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty	Part Number	Description	Batch
-----	-------------	-------------	-------

A/R Sikaflex-291

Sikaflex expire date:

Start Time: 8:45

Date: 8-11-13

Fin Time: 8:00 AM

Date: 8-11-14

7 Job 8-11-13

AWM 8-11-13

5.0

BENDING

BENDING MACHINE - SKIDTUBES



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

SL 8-11-24

6.0

SKIDTUBES 1

SKIDTUBES RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends after cutting. Remove alodine from around holes

2-Drill extra fwd hole as per DEO 9183 using drill jig DT8461

3-Drill extra middle hole as per DEO 9183 using drill jig DT8462

4-Drill pilot holes for aft cap using DT8215, \*\*\*DO NOT OPEN TO FINISH SIZE\*\*\*

5-Drill extra aft holes as per DEO 9183 using drill jig DT8463 locating from aft cap hole and aft saddle hole.

AWM 8-11-17

7 Job 8-11-13

AWM 8-11-17

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 23/10/2008 1:22:43 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 42893A

Part Number: D205634045

Job Number:



Seq. #: Machine Or Operation: Description :

7.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

*BE 08/11/17*

8.0

D25763

Step (maching detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2576-3	Step	<i>38392</i>

*BE 08/11/17*

9.0

D2579

Crossbolt Spacer



Comment: Qty.: 24.0000 Each(s)/Unit Total: 24.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
24	D2579	Spacers	<i>B-41666</i>

*AWM 8-11-17*

*24*

10.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

1-Prepare tube for welding D2576-3 Step Remove alodine as required.

2-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R

Aluminum Rod

*M109813*

*BE 08/11/17*

3-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004. For D2579

spacers, weld one

side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R

Aluminum Rod

*M109813*

*BE 08/11/17*

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

5-Drill holes for wearplates using DT 8217 Open holes to 19/64", adjust stopper not to hit web. Deburr

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Deburr holes

\*\*\*\*\*DO NOT COUNTERBORE EXTRA HOLES PUT IN AT STEP 13,14 AND 15 (LEAVE AT 0.384"Ø AS PER DEO 9183)\*\*\*\*\*

7-Open aft cap holes to #6 Drill bit. Deburr

8-Drill pilot holes for Tow ring using DT8091, open to .640" and Deburr

*PI0*

*K 8-11-18*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D205-634-045 PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR: <u>42893A</u>		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
8/11/19	#103	During QC 10 inspection found a welding pin hole at the 10th hole from alt. PC concentration contamination during welding	<i>[Signature]</i>	touch up area as per QS1004 and grind flush. AK m109813	BE 08/11/19	<i>[Signature]</i> 08/11/19	<i>[Signature]</i>	<i>[Signature]</i>

NOTE: Date & initial all entries

Date: Thursday, 23/10/2008 1:22:43 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 42893A

Part Number: D205634045

Job Number:



Seq. #: Machine Or Operation: Description :

11.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

S 08/11/19 (X)

12.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 08/11/19 (X)

13.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1  
Pressure wash as per QSI 005

M-H 08/11/26 (1X)

14.0

POWDER COATING

POWDER COATING



M 102316



Comment: POWDER COATING

Powder Coat \*\*\*\*GREEN\*\*\*\*Sandtex (Ref: 4.3.5.8) as per QSI 005 4.3

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

1:15  
320 OF  
1:45

M-H 08/12/15  
M-H 08/11/26

15.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



JS



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

08-12-06 (X)

16.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Cap

Batch: 1342806

JS

17.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Bolt

Batch: M100188

JS

08-12-16 (X)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector	
			Initial Chief Eng	Action Description Chief Eng				Sign & Date

**NOTE:** Date & initial all entries



Date: Thursday, 23/10/2008 1:22:43 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 42893A

Part Number: D205634045

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

18.0	AN960JD10L	Washer
------	------------	--------



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Washer

Batch: M105793

JW

19.0	AN960C10L	washer
------	-----------	--------



Comment: Qty.: 50.0000 Each(s)/Unit Total: 50.0000 Each(s)

washer

batch M109798

JW

20.0	ALS71032130	Insert
------	-------------	--------



Comment: Qty.: 50.0000 Each(s)/Unit Total: 50.0000 Each(s)

Insert

Batch: M105819

JW

\*

21.0	AN3C4A	BOLT
------	--------	------



Comment: Qty.: 50.0000 Each(s)/Unit Total: 50.0000 Each(s)

BOLT

Batch: M109798

JW

22.0	D356613	Gasket
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

Batch: B42147

JW

23.0	D35665	Gasket
------	--------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

Batch: B41467

JW

24.0	D35661	Gasket
------	--------	--------



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

GASKET

Batch: B43264

JW

08.12 - 46

(X)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 23/10/2008 1:22:43 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 42893A

Part Number: D205634045

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

25.0	D356413	Wearshoe
------	---------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1342257

Handwritten initials

26.0	D356411	Wearshoe
------	---------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1343707

Handwritten initials

27.0	D35649	Wearshoe
------	--------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1342258

Handwritten initials

28.0	D35645	Wearshoe
------	--------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1343408

Handwritten initials

29.0	D25943	O-Ring, 205 Skidtube
------	--------	----------------------



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

O-Ring

Batch: 1329408

Handwritten initials

30.0	D25941	Plug, 205 Skidtube
------	--------	--------------------



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Plug

Batch: 1342807

Handwritten initials

31.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R

Sikaflex-291

M110110

Handwritten initials

oe- 12-16-00

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D205-634-045 PAR #: N/A Fault Category: Prod / Skd tube NCR: Yes No DQA: AP Date: 08/12/19  
 Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR: <u>42893A</u>		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
8/12/19	#60	The Aft holes per Dwg 9183 were found too close by 0.080" holes not to Dwg. we noticed at step #31. <del>Not measured at inspection</del>	<i>[Signature]</i>	→ See NCR 08-116 - Fabricate qty 44 0.5 x 0.115" with 0.080" x 15° chamfers. out of 606/T6 Bar in 105671	<i>[Signature]</i> 08/12/11	08-12-12	<i>[Signature]</i>	8/12/19
	Found at Step #31.	R.C. Sg DT 8463 in incorrect and Tube were inspected *Lack of Attention*	<i>[Signature]</i>	Remove 2 x bolt spacers in Aft weld plus in to place per assembly A/E 109560	08-12-11	08-12-12	<i>[Signature]</i>	8/12/19
			<i>[Signature]</i>	Grinds weld flush inside and out. Mark out new hole per Dwg in correct location	08-12-11	08-12-12	<i>[Signature]</i>	8/12/19
			<i>[Signature]</i>	Drill and install 1/8" bolt spacer B 41666 x2 and weld in to place per AS7004 A/E 109560	08-12-11	08-12-12	<i>[Signature]</i>	8/12/19

NOTE: Date &amp; initial all entries

Date: Thursday, 23/10/2008 1:22:43 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 42893A

Part Number: D205634045

Job Number:



Seq. #:

Machine Or Operation:

Description :

✓ Sikaflex expire date: 09/10/07

2 2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

✓ 3-Inspect for foreign object per QSI 024

✓ 4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291 M110110

✓ Sikaflex expire date: 09/10/07

1 5-Wing Walk as per Dwg D2580 and QSI 005 4.4

Batch: M109917

32.0

QC5

INSPECT WORK TO CURRENT STEP



S 08/12/17 (10)



Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

33.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-045

Location:

PPP Rev:

PPP 42893

08/12/17 (1)

34.0

QC21

FINAL INSPECTION/W/O RELEASE



08/12/18 (1)

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



08/12/18

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**DART**


DESIGN RF	DRAWN BY RF	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. DEO 9183	REV. B SHEET 1 OF 1
DATE 00.05.15		TITLE ADD SKIDTUBE P/N D2580-045	SCALE NTS
A	00.03.29	NEW ISSUE	
B	00.05.15	39.580 WAS 39.620	

## DART ENGINEERING ORDER

AMEND DRAWING D2580 REV. C TO ADD D2580-045 ASSEMBLY

D2580-045 IS IDENTICAL TO D2580-041, EXCEPT FOR THE FOLLOWING CHANGES:

- 1) INSTALL CROSS BOLT SPACERS AT LOCATIONS MARKED 'X' ACCORDING TO THE FOLLOWING PROCEDURE.
  - a) DRILL  $\varnothing 0.508$  HOLES AT LOCATIONS SHOWN BELOW MARKED 'X'. CHAMFER HOLES  $0.030 \times 45^\circ$ . NOTE THAT HOLES WILL ALSO HAVE TO BE TRANSFERRED TO THE D2596 WEB AT THE \* LOCATIONS. IT IS ACCEPTABLE TO PRE-DRILL THE D2596 WEB IN THESE LOCATIONS BEFORE INSTALLING THE WEB IN THE SKIDTUBE. OPEN HOLES TO  $\varnothing 0.63$  AND TOUCH UP WITH ALODINE PER QSI 005 4.1.
  - b) INSERT D2579 CROSS BOLT SPACERS INTO THE HOLES.
  - c) WELD INTO PLACE PER DART QSI 004 AND GRIND FLUSH.
  - d) REMOVE SPILL OVER LEAVING HOLE DIMENSION  $\varnothing 0.380$ - $\varnothing 0.390$ .
- 2) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION.
- 3) POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3 INSTEAD OF WHITE (REF. 4.3.5.1).

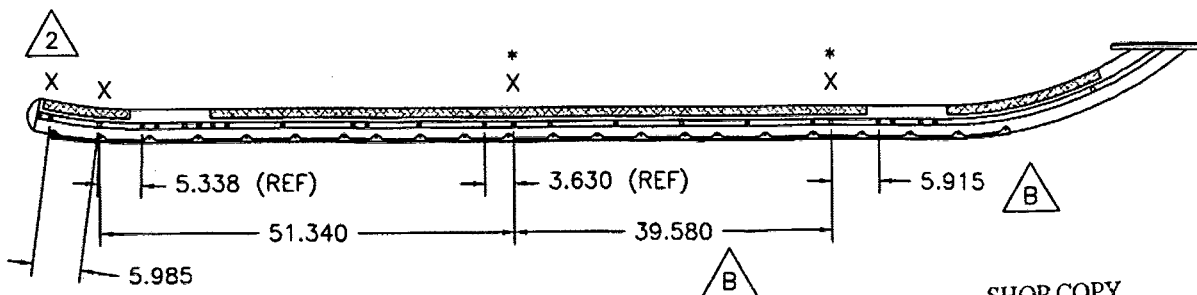

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 42393A

Copyright © 2000 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.



DESIGN RF	DRAWN BY RF	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED [Signature]	APPROVED [Signature]	DRAWING NO. DSI 9184	REV. A SHEET 1 OF 1
DATE 00.03.29		TITLE ADD SKIDTUBE P/N D205-634-015 SCALE NTS	
A	00.03.29	NEW ISSUE	

## DART SERVICE INSTRUCTION

TO AMEND INSTALLATION INSTRUCTIONS D205-634 REV. B.

REF. CANADIAN STA: SH96-88  
US FAA STC: SR00563NY

ADD D205-634-015 INSTALLATION. PARTS LIST IS IDENTICAL  
TO PARTS LIST FOR D205-634-011 EXCEPT THAT:  
D205-634-045 REPLACES D205-634-041  
D2580-045 REPLACES D2580-041

THE DIFFERENCE BETWEEN D205-634-011 (D205-634-041)  
AND D205-634-015 (D205-634-045) IS THAT EXTRA  
SPACERS HAVE BEEN ADDED AT LOCATIONS MARKED 'X' AND  
ASSEMBLY IS PAINTED GREEN.



D205-634-015 (D205-634-045)

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 42893A

Copyright © 2000 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.



W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_

NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date &amp; initial all entries

**DART**

DESIGN #	DRAWN BY RH	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D2580	REV. D SHEET 1 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	
D	07.02.27	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	

**RELEASED**  
07-06-28 #

QTY -041	QTY -045	Part Number	Description
X		D2580-041	SKIDTUBE ASSEMBLY
	X	D2580-045	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
1	1	D2576-3	STEP
20	24	D2579	CROSS BOLT SPACER
16	16	D2594-1	PLUG
16	16	D2594-3	O-RING
1	1	D2596	205 WEB
1	1	D2855	AFT CAP
1	1	D3564-5	WEARSHOE
1	1	D3564-9	WEARSHOE
1	1	D3564-11	WEARSHOE
1	1	D3564-13	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1	1	D3566-13	GASKET
50	50	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
50	50	AN3C4A	BOLT
2	2	AN3-5A	BOLT
50	50	AN960C10L	WASHER
2	2	AN960JD10L	WASHER

**GENERAL NOTES:**

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) ALL DIMENSIONS ARE IN INCHES
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/-291.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:  
SEE NOTES ON  
PAGE 2 FOR D2580-041 AND  
PAGE 3 FOR D2580-045
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 42893A

**Copyright © 1996 by DART AEROSPACE LTD**

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


**NOTE:** Date & initial all entries

**DETAIL A**  
SCALE 5:24

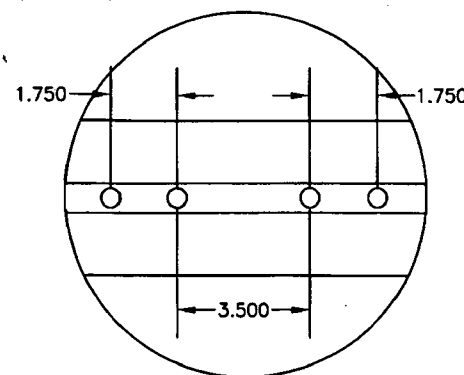


**RELEASED**  
07.06.28


**DETAIL B**  
SCALE 5:24

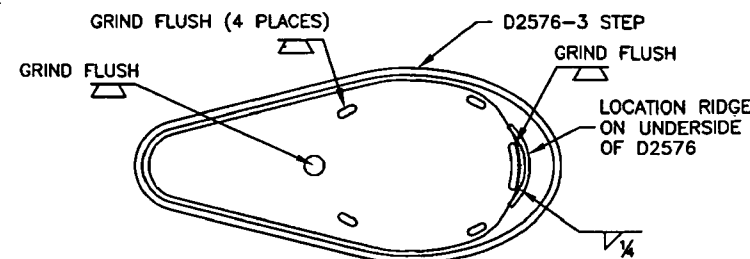

**DETAIL C**  
SCALE 5:24

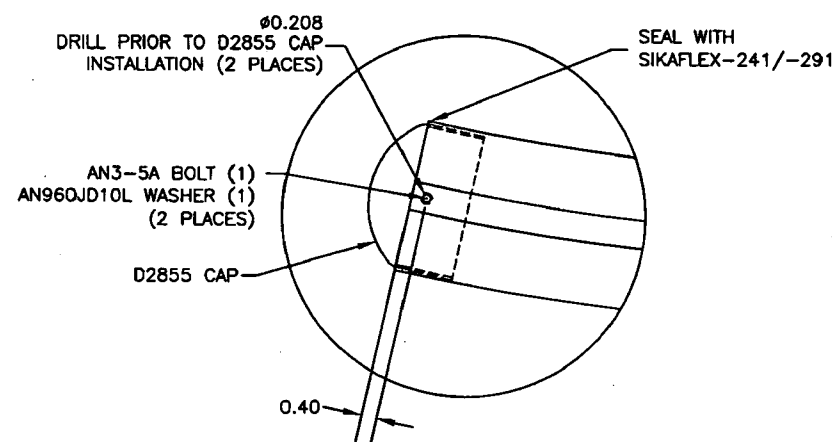


**SECTION D-D**  
SCALE 5:24

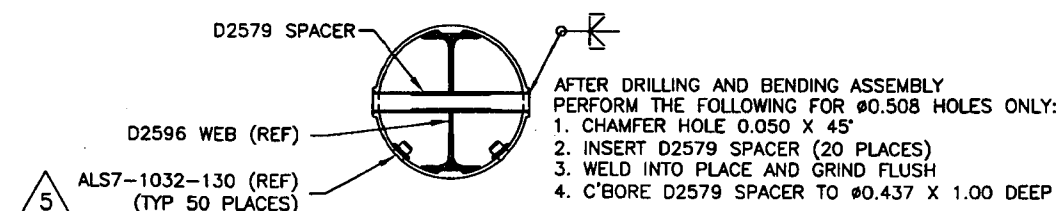


**D2580-041 NOTES**

- i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB  
POWDER COAT ASSEMBLY GLOSS WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3  
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4


**D2580-1 DRILLING DETAIL**

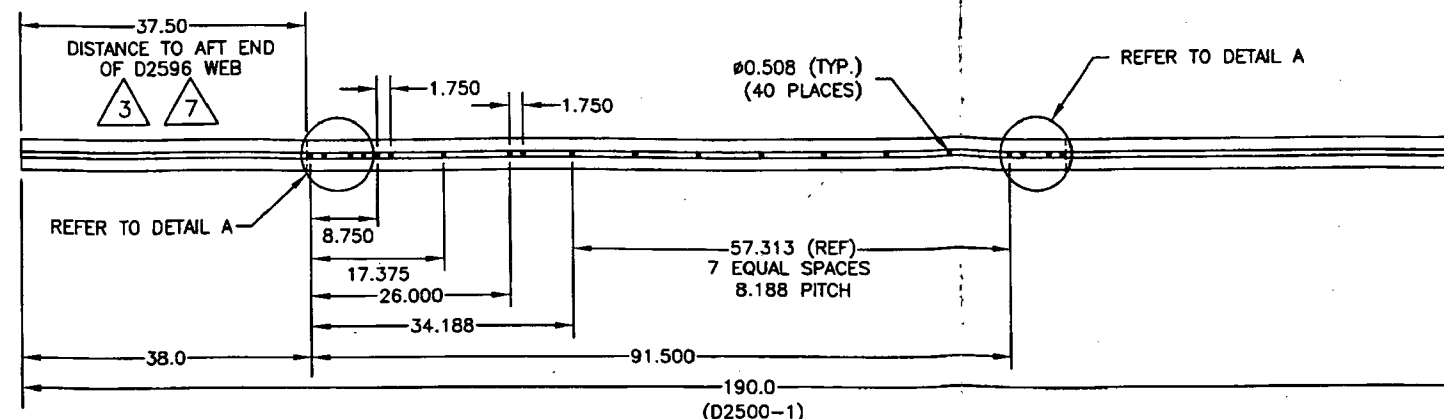

**D2580-1 BENDING AND CUTTING DETAIL**

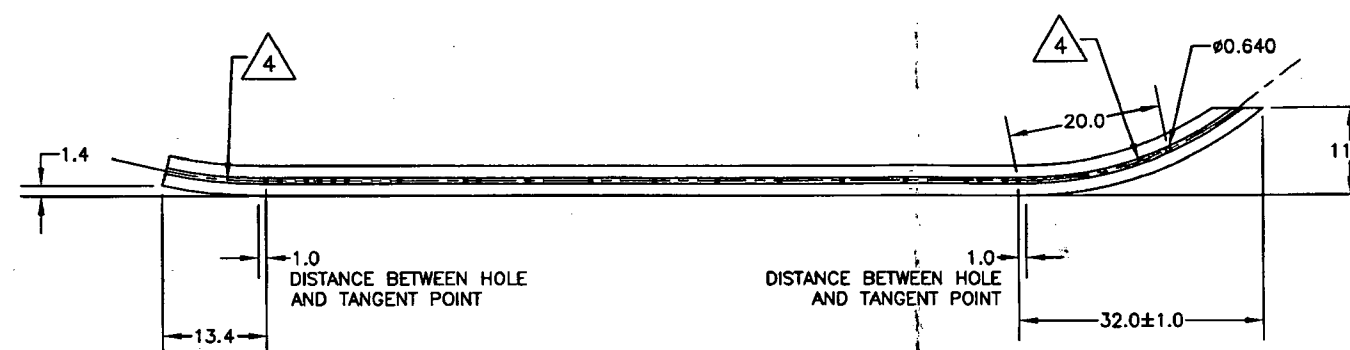


**D2580-041 ASSEMBLY DETAIL**

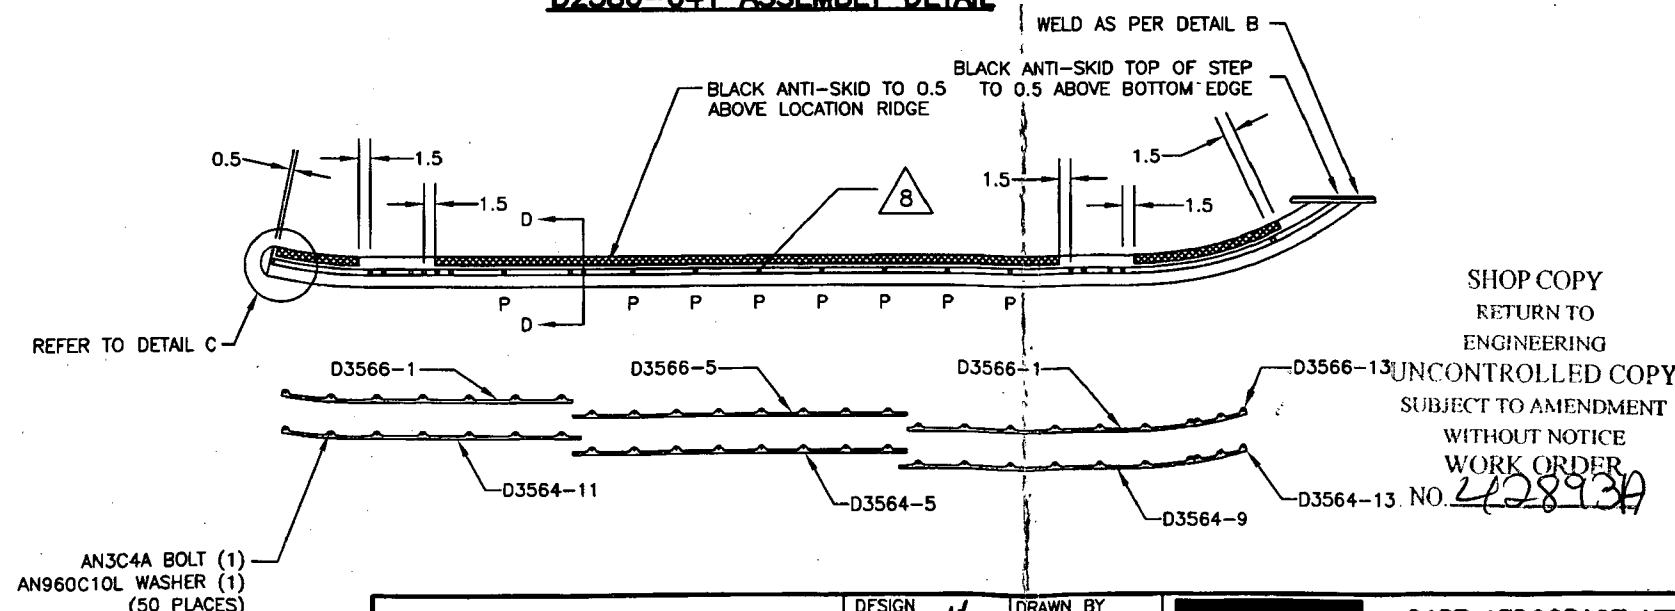


SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 428939

COPYRIGHT © 1996 BY DART AEROSPACE LTD.		DESIGN	DRAWN BY	<b>DART</b>	DART AEROSPACE LTD. HAWKESBURY, ONTARIO, CANADA
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED	APPROVED		
DATE		07.02.27		DRAWING NO.	REV. D
				D2580	SHEET 2 OF 3
				TITLE	SCALE
				205 SKIDTUBE ASSEMBLY	1:24

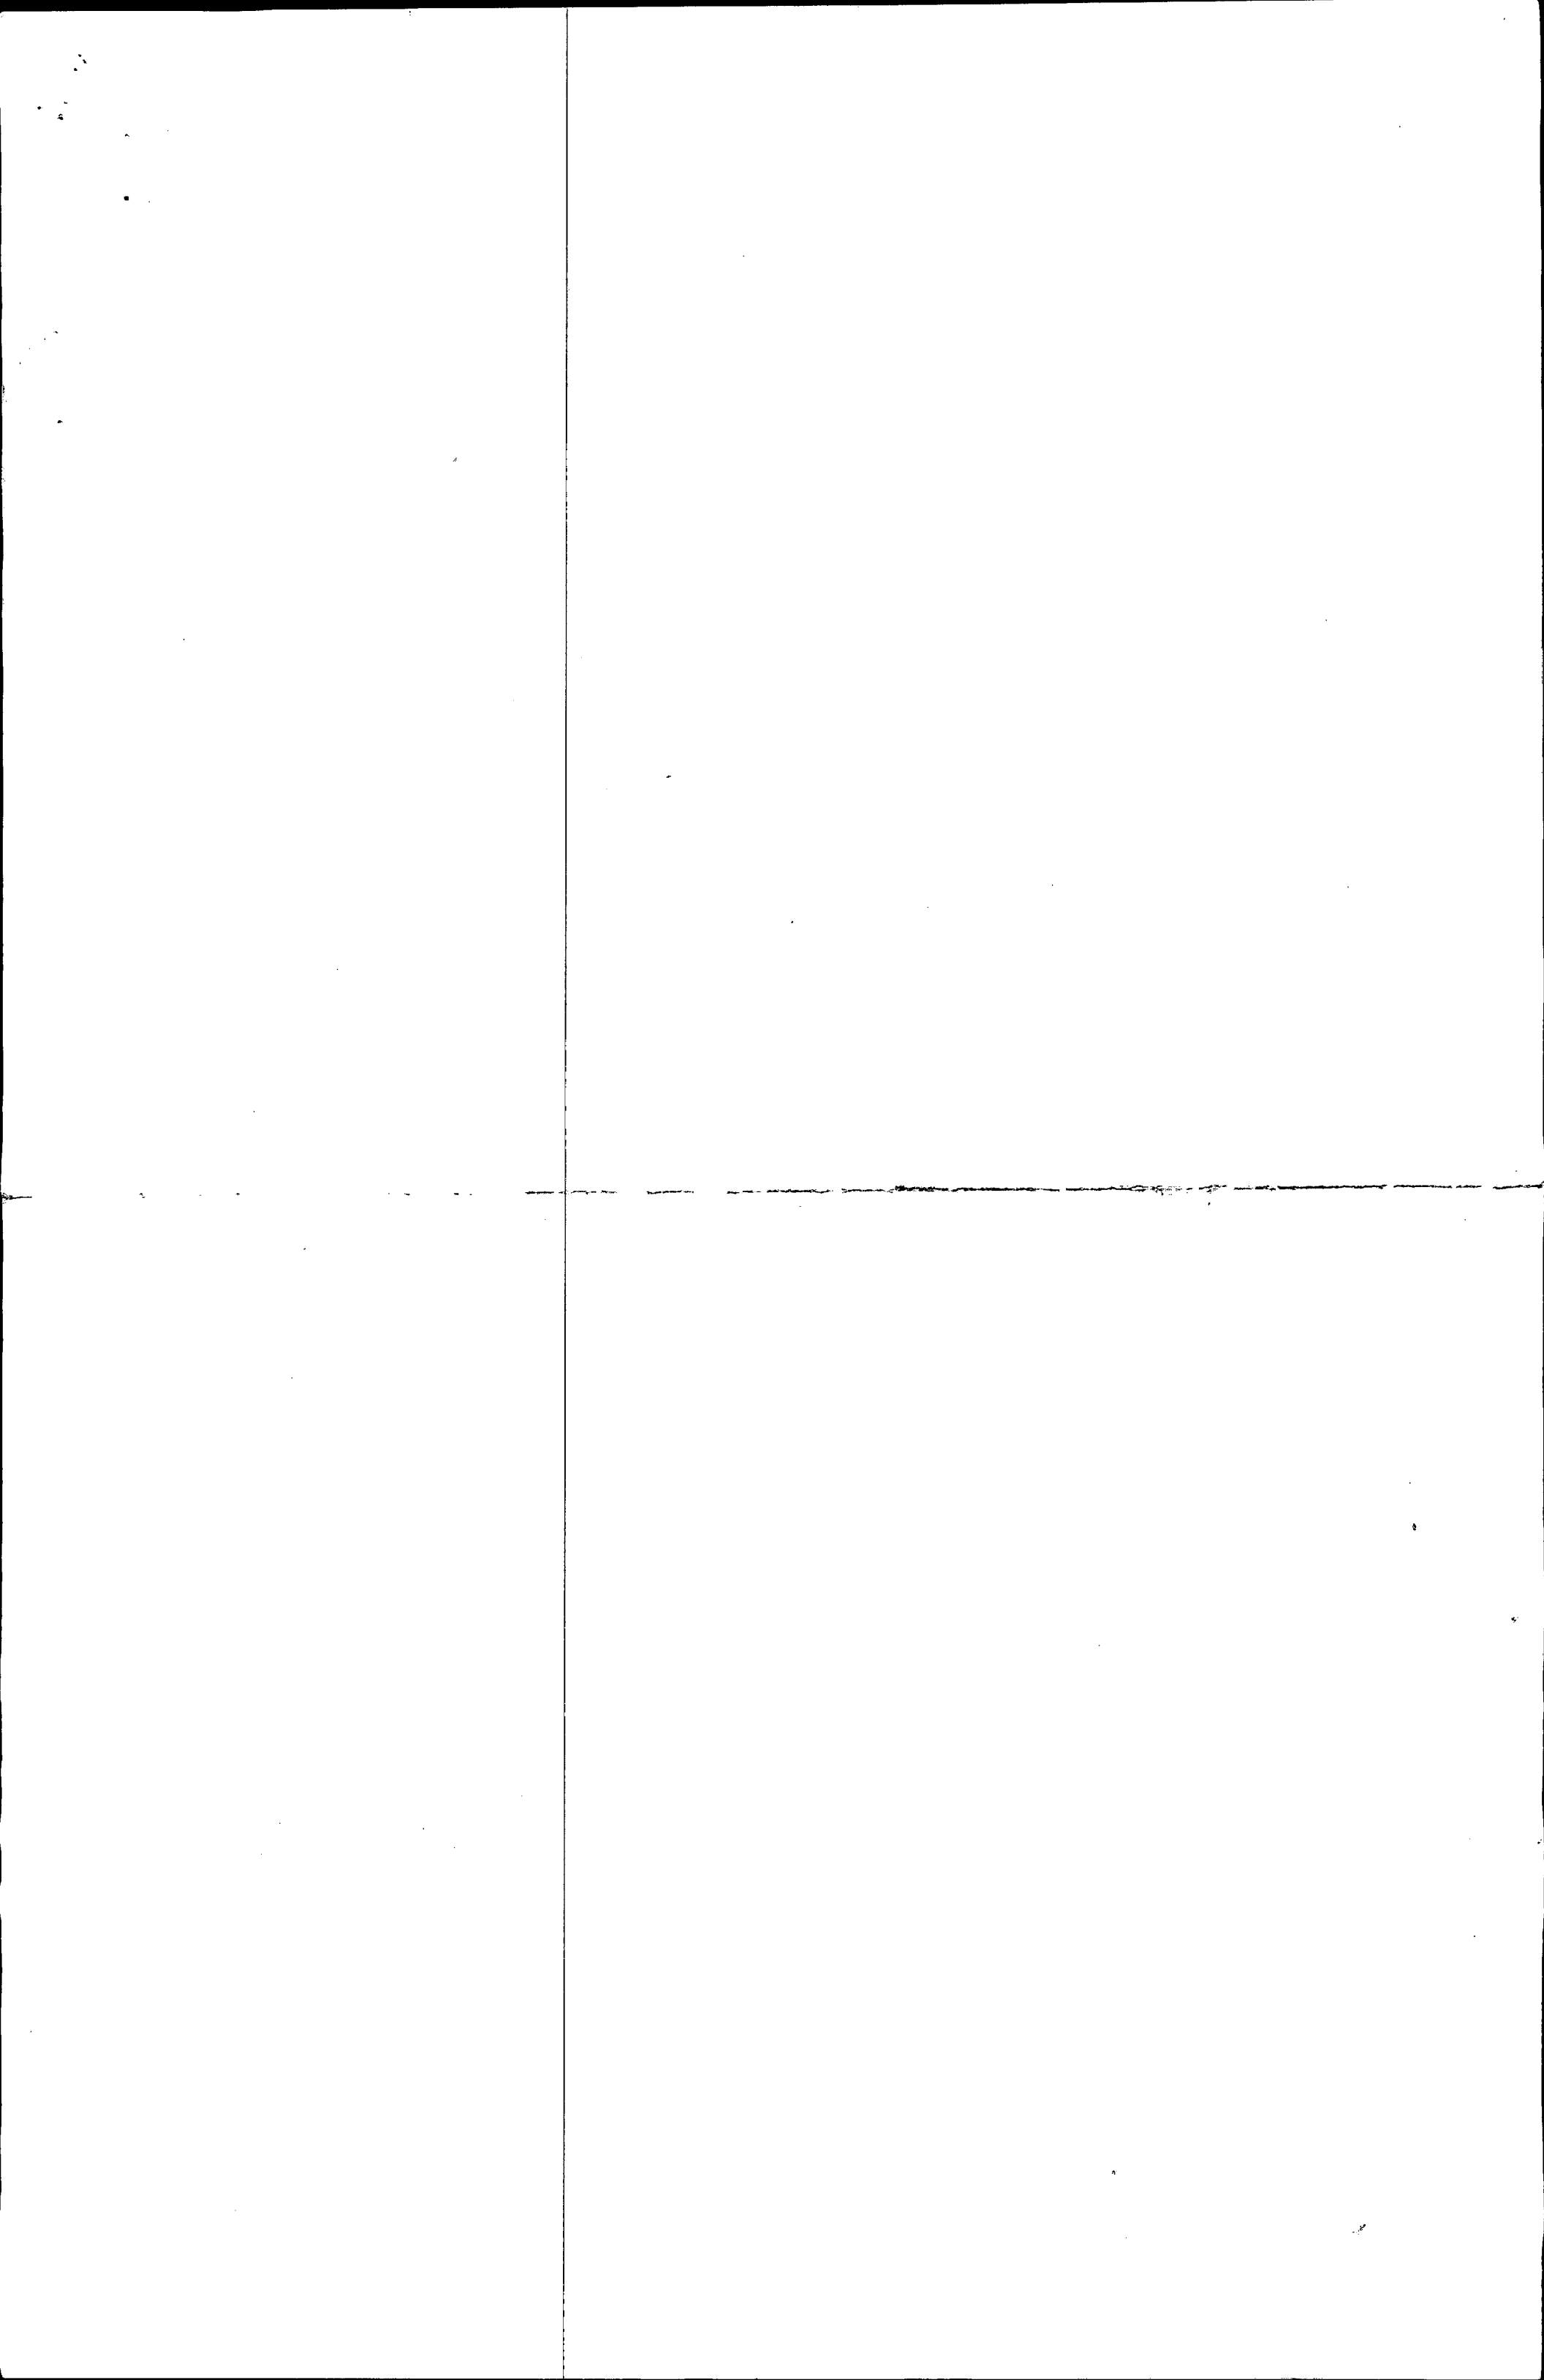


**DETAIL E**  
SCALE 5:24

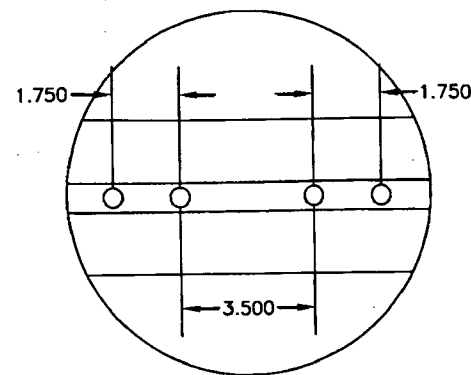


**RELEASED**  
07 Dec 78


**DETAIL F**  
SCALE 5:24

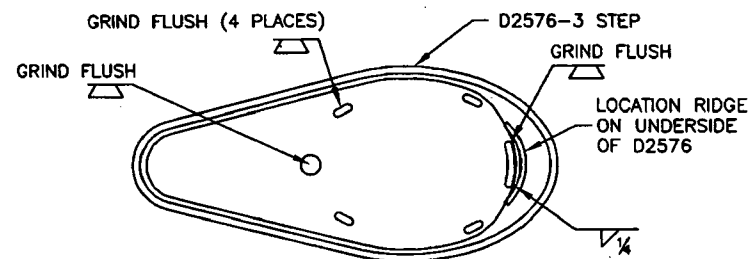


**DETAIL G**  
SCALE 5:24

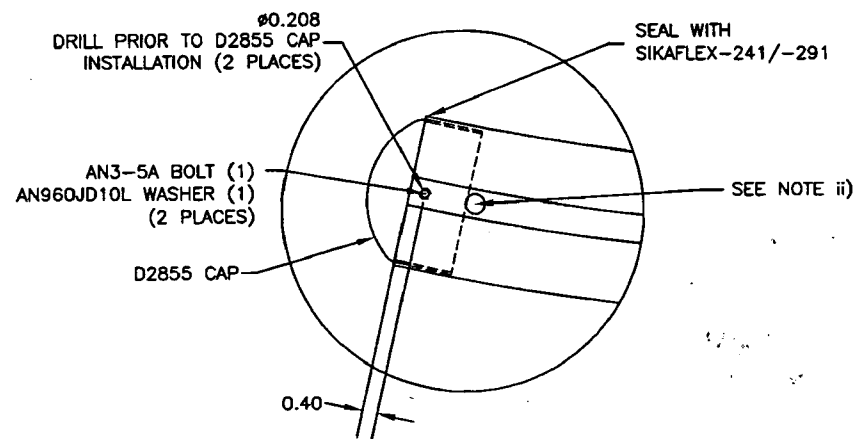


**SECTION H-H**  
SCALE 5:24

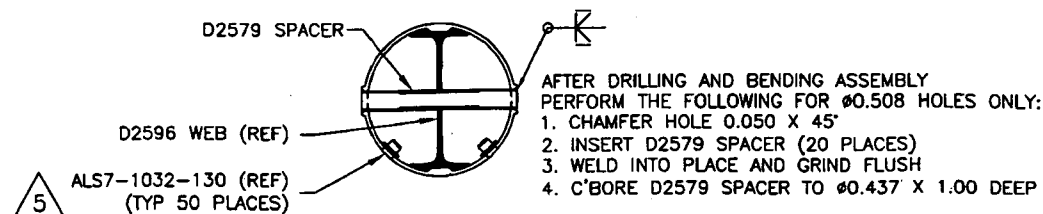


**D2580-1 DRILLING DETAIL**

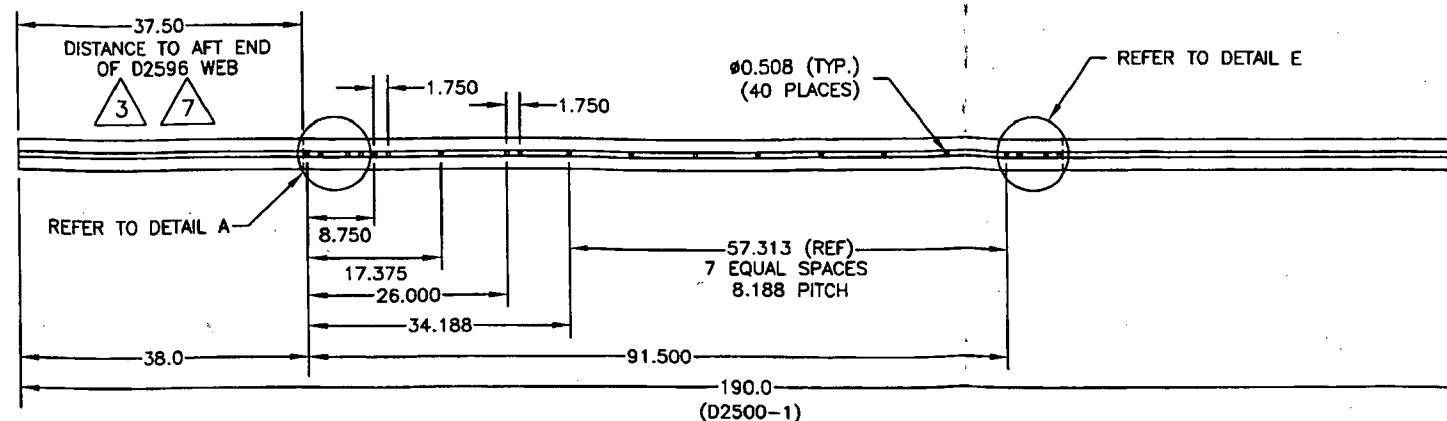

**D2580-5 BENDING AND CUTTING DETAIL**  
(MAKE FROM D2580-1 DRILLING DETAIL)

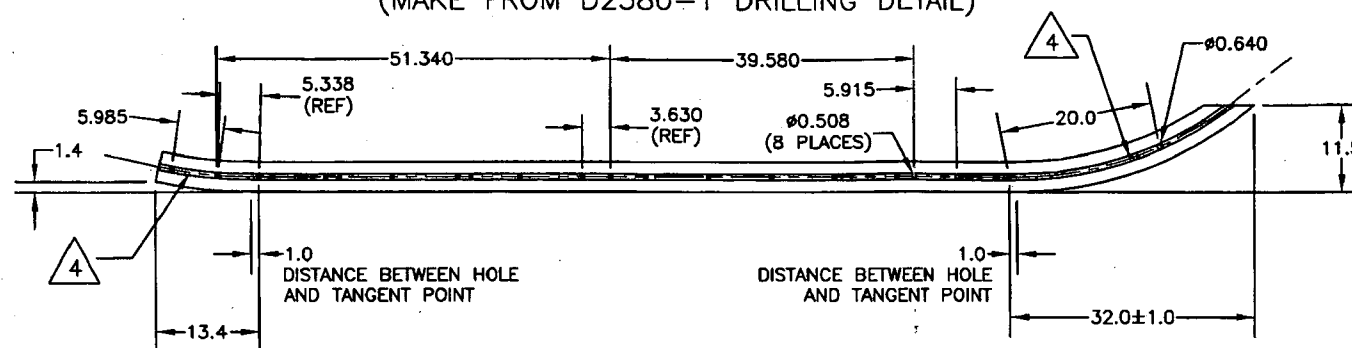

**D2580-045 ASSEMBLY DETAIL**

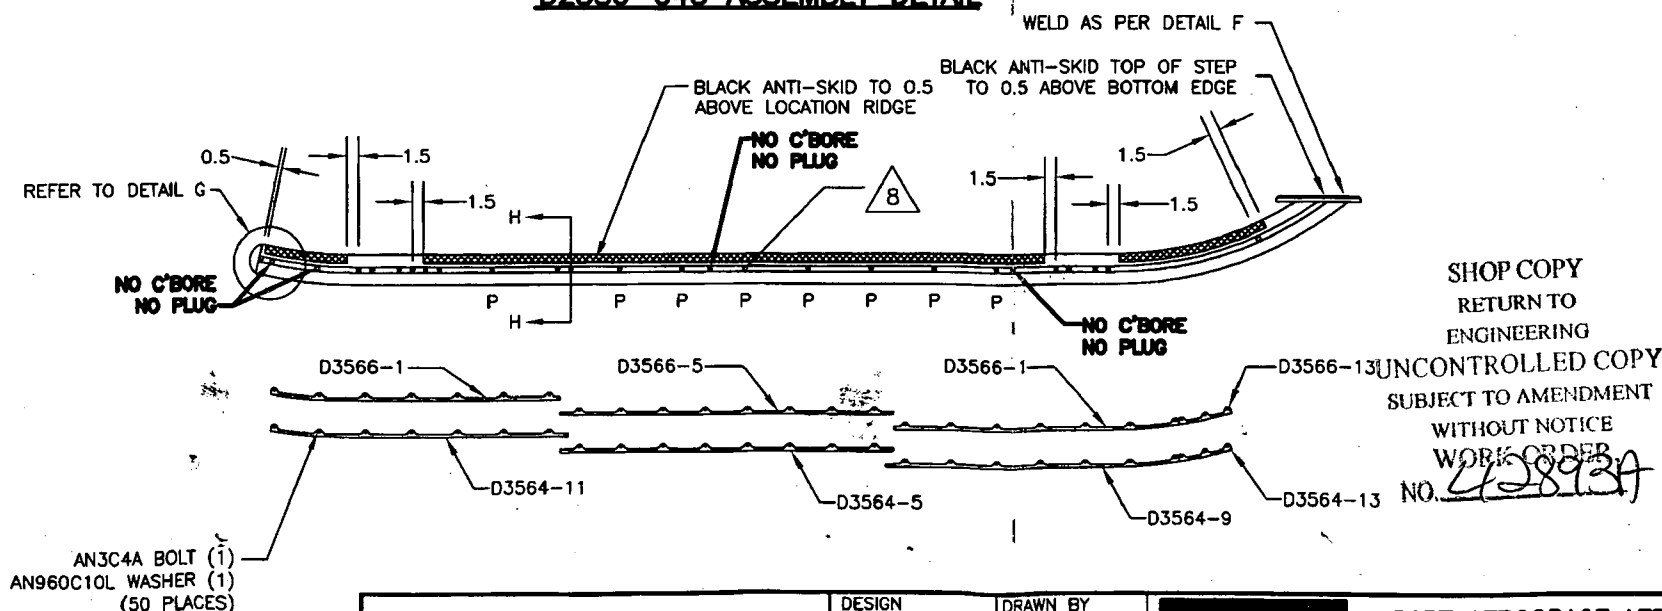


SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER NO. 42892A

**D2580-045 NOTES**

- FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4
- IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

COPYRIGHT © 1996 BY DART AEROSPACE LTD.		DESIGN RH	DRAWN BY RH	<b>DART</b>	DART AEROSPACE LTD. HAWKESBURY, ONTARIO, CANADA
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED H	APPROVED H	DRAWING NO. D2580	REV. D SHEET 3 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY.		SCALE 1:24	

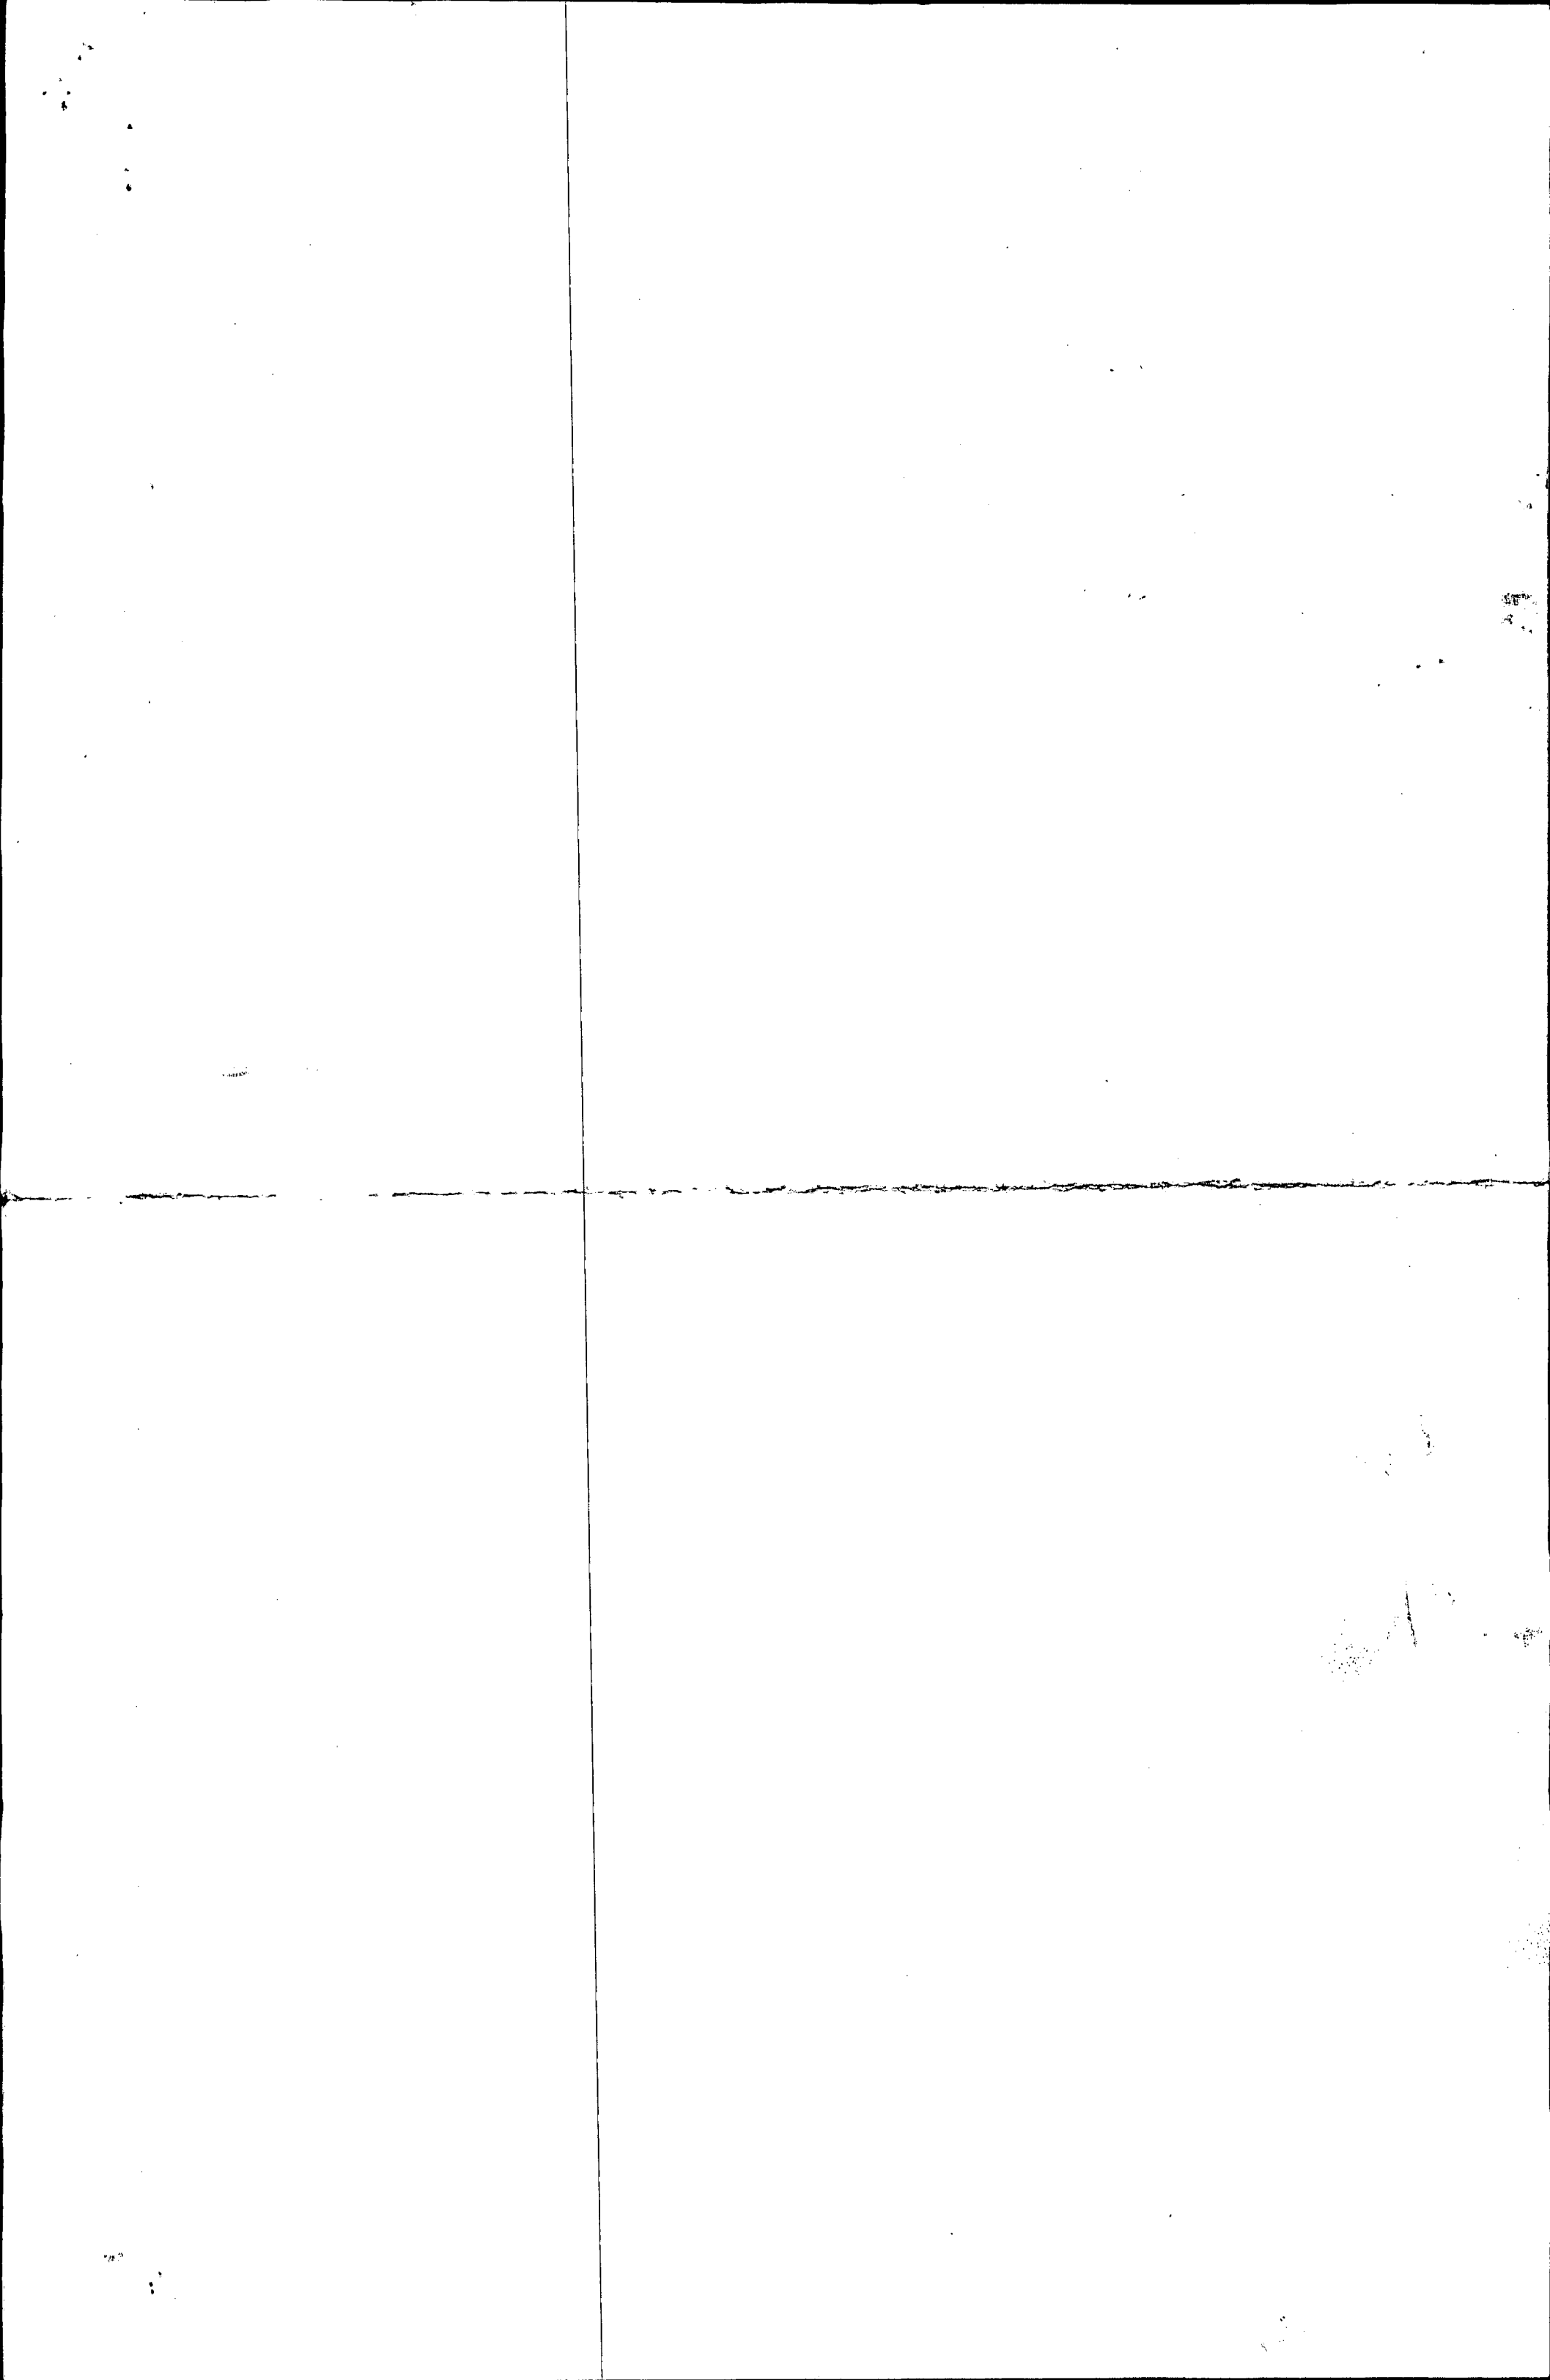

NO. 173

AWS D17.1.2001  
QUALIFICATION TEST RECORD

Name: Barclay Elliott  
Job number: 41315 AD  
Part number: D204 635041  
Description: 204/205 shield tube  
Welding Process: Tig[☒] Mig[ ]  
Base material: Aluminium  
Current: AC[☒] DC[ ]

TEST REQUIREMENTS AND RESULTS

Visual: pass[☒] fail[ ]  
Penetration: pass[☒] fail[ ]

UNACCEPTABLE

Cracks: pass[☒] fail[ ]  
Undercut: pass[☒] fail[ ]  
Pin holes: pass[☒] fail[ ]  
Overlap (cold lap): pass[☒] fail[ ]  
Porosity (surface): pass[☒] fail[ ]  
Coloration: pass[☒] fail[ ]

Qualifier Pat Duval Date of Test Coupon 08-09-24  
Welder Barclay Elliott Date of Test Coupon 08-09-24

The above named individual is qualified in accordance with AWS D17.1.2001 to weld